



Turin, 5th March 2013

CAMPAIGN 5707 - Service Campaign
Model: Fiat Ducato "recreational" version
- rear fog light wiring

On 62 Fiat Ducato vehicles, recreational versions, whose chassis numbers are listed in Attachment (Annex 1) and range between 2299074 and 2348976, the wiring for the second rear fog light might be absent, due to a non-compliance.

On today's date, all vehicles are still at the bodywork fitters' premises.

Therefore, it is compulsory to make a pre-delivery intervention on vehicles before the delivery to the final customers, implementing the cycle described in Attachment (Annex 2) to upgrade all vehicles.



Jeep



Annex 1**Model: Fiat Ducato "recreational" version
- rear fog light wiring**

Frame	Market	Frame	Market
2299074	3239-TURKEY	2345513	3303-ANGOLA
2299206	3239-TURKEY	2345648	3303-ANGOLA
2300233	3239-TURKEY	2345682	3303-ANGOLA
2300692	3239-TURKEY	2345731	3303-ANGOLA
2319981	3239-TURKEY	2345810	3303-ANGOLA
2324316	3239-TURKEY	2345841	3303-ANGOLA
2329165	3239-TURKEY	2345912	3303-ANGOLA
2329644	3239-TURKEY	2345993	3303-ANGOLA
2329646	3239-TURKEY	2346054	3303-ANGOLA
2330954	3239-TURKEY	2346237	3303-ANGOLA
2331551	3239-TURKEY	2346321	3303-ANGOLA
2331635	3239-TURKEY	2346348	3303-ANGOLA
2331753	3239-TURKEY	2346408	3303-ANGOLA
2331759	3239-TURKEY	2346421	3303-ANGOLA
2332071	3239-TURKEY	2346622	3303-ANGOLA
2334578	3239-TURKEY	2346899	3303-ANGOLA
2342387	3239-TURKEY	2346936	3303-ANGOLA
2342457	3239-TURKEY	2346940	3303-ANGOLA
2342501	3239-TURKEY	2346950	3303-ANGOLA
2342547	3239-TURKEY	2347175	3303-ANGOLA
2342601	3239-TURKEY	2307198	3351-TUNISIA
2342634	3239-TURKEY	2307331	3351-TUNISIA
2342818	3239-TURKEY	2307404	3351-TUNISIA
2342858	3239-TURKEY	2307983	3351-TUNISIA
2343026	3239-TURKEY	2308842	3351-TUNISIA
2344462	3239-TURKEY	2348976	3524-NEW CALEDONIA
2344470	3239-TURKEY	2322980	3566-MACEDONIA
2344552	3239-TURKEY	2323189	3566-MACEDONIA
2345048	3239-TURKEY	2324091	3566-MACEDONIA
2345364	3239-TURKEY	2324445	3566-MACEDONIA
2345540	3239-TURKEY	2324907	3566-MACEDONIA



CAMPAIGN

Service Campaign

5707

COMPONENT:	Rear fog light power supply wiring		
FAULT:	Layout not correct		
VERSION:	Ducato, with cab and chassis/with chassis cowl models		
CONCERNED VEHICLES:	All vehicles with chassis numbers listed in SIGI. (Chassis ranging between 2299074 and 2348976) Vehicles assigned to you: consult your PC for the chassis numbers involved in the campaign.		
TECHNICAL CAUSE:	Production process		
RELEASE NO.:	0		
MATERIAL:	Description:	Part No.:	Q.ty:
	Rear fog light wiring	1375878080	01
	Cable ties	14560187	10
SPECIAL TOOLS:	-		
EPLUS ORDER UPLOADING METHOD:	-		
REMUNERATION:	Cost:	Campaign:	Operation:
MANPOWER AND MATERIAL:	A01	5707	A
MISCELLANEOUS (MAIL, ETC.):	A10	5707	-
SOLUTION IN PRODUCTION:	The assembly of complying vehicles is guaranteed		
NETWORK INTERVENTION IDENTIFICATION:	A spot of white paint on fuse box		
	Therefore, it is compulsory to make a pre-delivery intervention to final customers, to upgrade all vehicles.		

OPERATING CYCLE

Position the vehicle on a lift.
Working in the vehicle operator's compartment, proceed as follows:

WARNING: before operating on the airbag system, strictly comply with the safety standards in force.






- Disconnect the negative battery terminal.
 - Remove the compartment floor mat, as shown, with reference to Op. 7040L10 of the Service Manual, to reach the left longitudinal wiring.
 - Take the new supply harness for rear fog lights from the Spare Parts Dpt. (see Part&Service availability).
 - Working in the right kick plate area, disconnect the electrical connection D221.
- With reference to Op. 5590E of the Service Manual:
- Fit the terminal of the new harness in the block, pin 4 cavity, as shown.
 - Fit the block in the shell and suitably protect the connection using insulating tape.
 - Make the harness (C) (marked in blue in the picture) pass through the duct seal (P), following the path of the left longitudinal harness (re. 23 on the Service Manual).

Lift the vehicle:



- Make the harness (C) (marked in blue in the picture) pass following the path of the longitudinal left wiring, until reaching connection D224.

With reference to Op. 5590E of the Service Manual:

- Take out the protection plug from the pin 10 cavity of the connector block, then fit the terminal of the new harness.
- Suitably protect the connection with insulating tape.

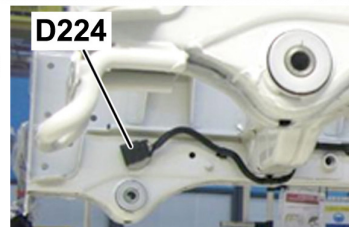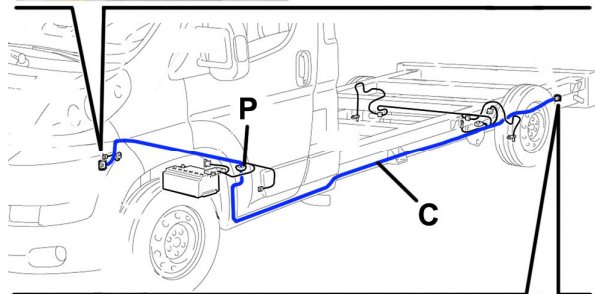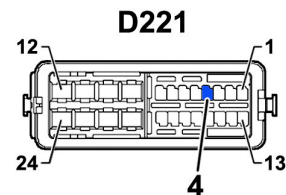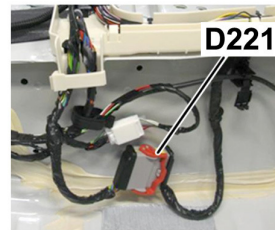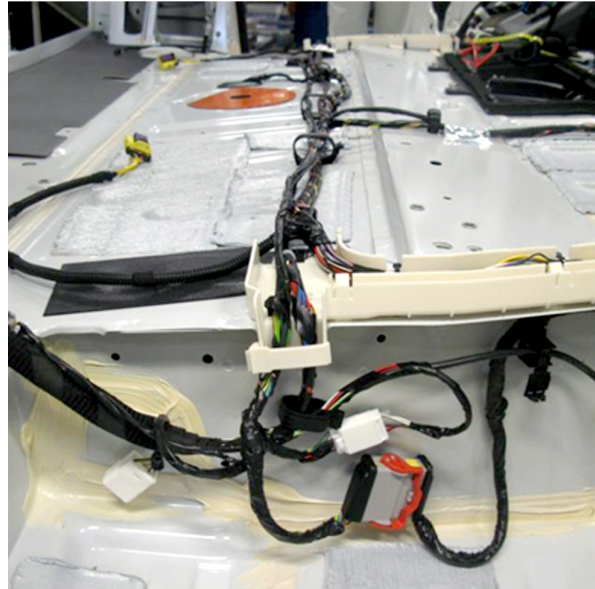


- Secure the new harness (C) to the available clips and, where they are missing, fasten using some ties (S) (see Part&Service availability).

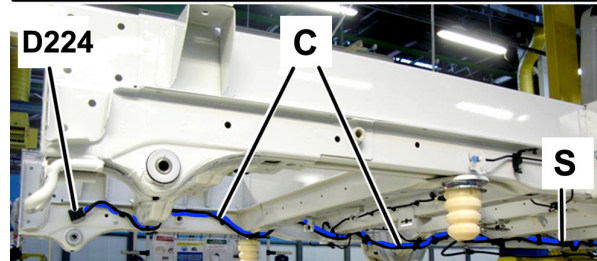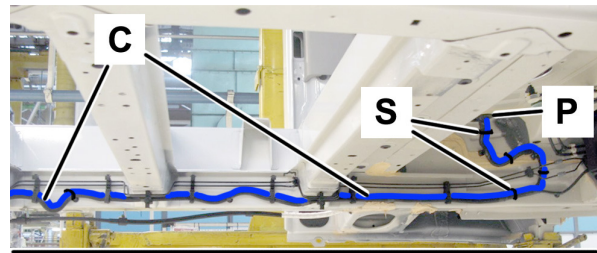

Lower the vehicle and, acting on the compartment floor:

- Secure the new harness (C) to the available clips and, where they are missing, fasten using some ties (S) (see Part&Service availability).
- Refit the compartment floor mat, with reference to Op. 7040L10 of the Service Manual.
- Connect the negative battery terminal.

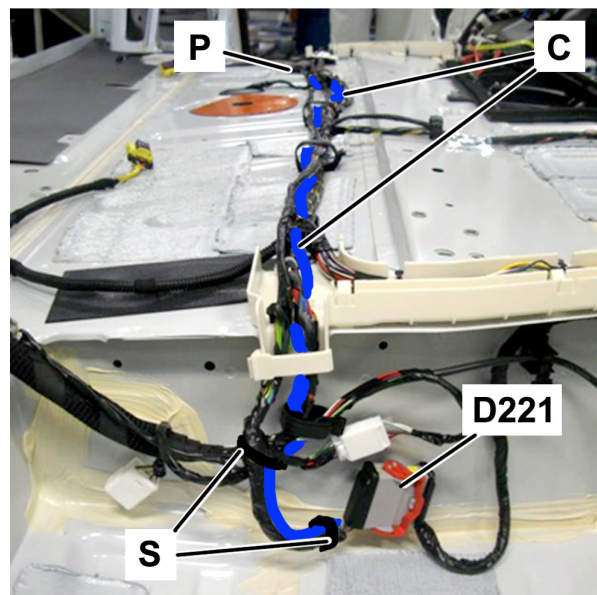

Disposal of removed parts:

Removed part return required:

NO